

Pyranometer CMP 6

The WMO-recommended measuring value transmitter meets the ISO 9060 –classification
“First class“ Adjustable feet and a level allow an easy horizon-adjustment. Delivery includes calibration certificate

Specification

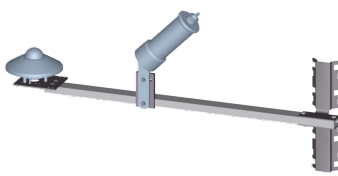
Part number: 7.1415.02.102

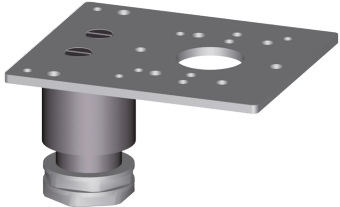
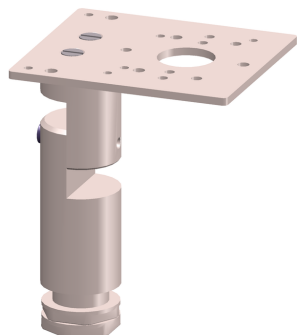
Radiation	
Measuring range	0 ... 2000 W/m²
Sensitivity	5 ... 15 µV/W/m²
Typ. Signal output	0 ... 15 mV
Spectral range	310 ... 2800 nm
Non-linearity	1 % @ 100 ... 1000 W/m²
Internal resistance	20 ... 200 Ω
Response time	6 sec @ 63 % vom Endwert 18 sec @ 95 % vom Endwert
Sensor type	Thermo-element mit 64 Einzelelementen
General	
Ambient temp.	-40 ... +80 °C
Electr. connection	Ohne Kabel
Dimension	Ø 150 x 92 mm
Weight	0.9 kg

Versions

No other versions of this product are available.

Accessories

Product	Product name	Brief description	
	Traverse 0,8 m 4.3171.40.002	For mounting of a Pyranometer CMP11 / 6 / 3 And a sunshine duration sensor-CSD3 onto a mast.	
		General	
		Clamping range	Ø 48 ... 102 mm
		Sensor distance	0.4 / 0.8 m from mast
		Material	Aluminium / Stainless steel
		Weight	1 kg

	Hanger 1 m (for radiation sensors) 4.3185.xx.009	The hanger is used for laterally mounting of a radiation- or brightness transmitter onto a mast. General Length 1 m Material Aluminium Tube diameter Ø 50 mm Weight 1.8 kg
	Adapter Compact 506345	The adapter serves for mounting a radiation transmitter, baro transmitter or brightness transmitter onto a traverse (4.3171.30.000, 4.3171.40.000) or holder (506 347). General Material Aluminium, anodized Dimension 100 x 115 x 65 mm Weight 0.5 kg
	Adapter Compact 0 ... 90 ° adjustable 508850	The adapter serves for mounting a radiation transmitter, baro transmitter or brightness transmitter onto a traverse (4.3171.30.000, 4.3171.40.000) or holder (506 347). General Material Aluminium, anodized Dimension 100 x 115 x 65 mm Weight 0.5 kg Function 0 ... 90 ° adjustable



Universal
Amplifier
7.1415.00.200

The Universal Amplifier serves for the connection of various sensors with voltage-, or PT100 output.

Data output digital

Interface RS485 / RS422
Baudrate 1200 ... 115200 Baud

Data output analog

Chanel 3
Output parameters 0 ... 1 V, 0 ... 5 V,
0 ... 10 V, 4 ... 20 mA,
0 ... 20 mA
Resolution 1/10000 FS

Data input analog

Chanel 4
Meas. range 0.1 ... 1V
resolution 1 μ V
switchable to -1 ... +10 V

Alternatively, each
channel is switchable to PT 100:
max. -99.0 ... +99.0 °C
PT100 resolution: 1/10, 1/100, 1/1000 °C, settable

General

Power supply 7 ... 24 V DC
Ambient temp. -40 ... +60 °C
Electr. connection Cable gland and terminal strip
Protection IP 65
Dimension 120 x 80 x 55 mm
Weight 0.25 kg
Matirial housing Polycarbonate

Preamplifier 7.1415.01.841	Instrument for transforming small mV-signals from the radiation sensor into a standardized voltage signal.	
	Data output analog	
	Chanel	1
	Output type	4 ... 20 mA
	Output range	0 ... 1600 W/m ²
	Data input analog	
	Chanel	1
	Input type	-10 ... 75 mV
	General	
	Power supply	7.5 ... 45 V DC (via 4 ... 20 mA lines)
	Ambient temp.	-40 ... +85 °C
	Electr. connection	2 x cable gland
	Protection	IP 66
	Dimension	64 x 98 x 34 mm
	Weight	0.3 kg
	Matirial housing	aluminium, powder coated

